11325   HYUNDAI SONATA GL & GLS
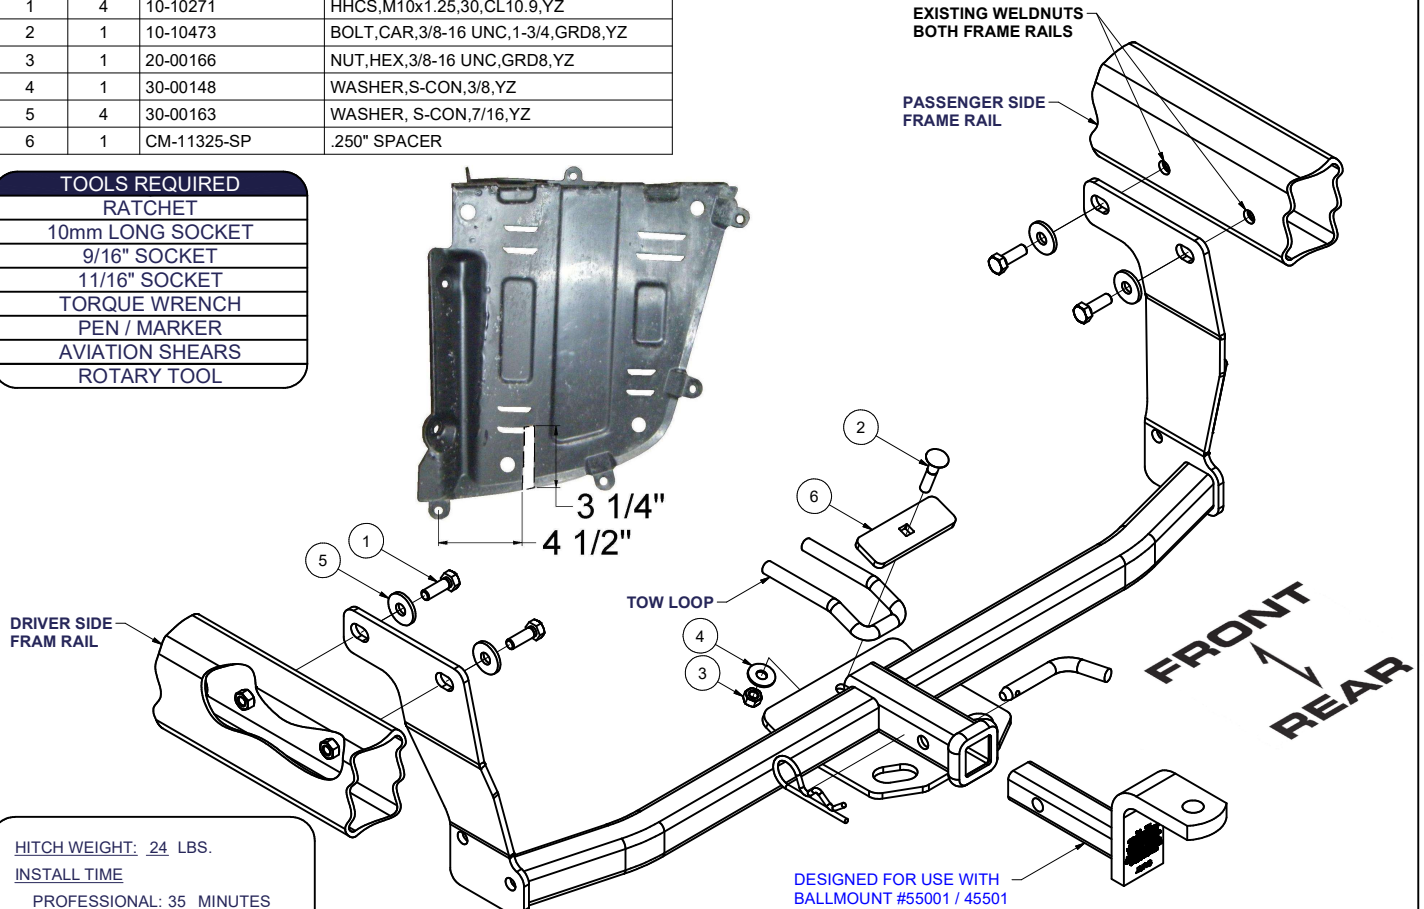
10/30/2020

GROSS LOAD CAPACITY WHEN USED AS A WEIGHT CARRYING HITCH: 2,000 LBS. TRAILER WEIGHT & 200 LBS. TONGUE WEIGHT.

DO NOT EXCEED VEHICLE MANUFACTURER'S RECOMMENDED TOWING CAPACITY.

WARNING: ALL NON-TRAILER LOADS APPLIED TO THIS PRODUCT MUST BE SUPPORTED BY AUXILIARY STABILIZING STRAPS.

** FAILURE TO PROPERLY SUPPORT NON-TRAILER LOADS WILL VOID PRODUCT WARRANTY**

HAVING INSTALLATION QUESTIONS? CALL TECHNICAL SUPPORT AT 1-877-287-8634

		Parts List	
ITEM	QTY	PART NUMBER	DESCRIPTION
1	4	10-10271	HHCS,M10x1.25,30,CL10.9,YZ
2	1	10-10473	BOLT,CAR,3/8-16 UNC,1-3/4,GRD8,YZ
3	1	20-00166	NUT,HEX,3/8-16 UNC,GRD8,YZ
4	1	30-00148	WASHER,S-CON,3/8,YZ
5	4	30-00163	WASHER, S-CON,7/16,YZ
6	1	CM-11325-SP	.250" SPACER

TOOLS REQUIRED
RATCHET
10mm LONG SOCKET
9/16" SOCKET
11/16" SOCKET
TORQUE WRENCH
PEN / MARKER
AVIATION SHEARS
ROTARY TOOL

EXISTING WELDNUTS BOTH FRAME RAILS

PASSENGER SIDE FRAME RAIL

DRIVER SIDE FRAM RAIL

TOW LOOP

FRONT   REAR

DESIGNED FOR USE WITH BALLMOUNT #55001 / 45501

3 1/4"
4 1/2"

HITCH WEIGHT: 24 LBS.

INSTALL TIME

  PROFESSIONAL: 35 MINUTES

  NOVICE (DIY): 70 MINUTES

INSTALL NOTES:
 - NO DRILLING REQUIRED
 - MAY REQUIRE FASCIA TRIMMING
 - MAY REQUIRE UNDERBODY PANEL
   TRIMMING

INSTALLATION STEPS

1. Remove plastic underbody panel (8) fasteners, if needed.

2. Remove the passenger side muffler heat shield by first removing the two rearmost muffler mounts. This will allow access to the four heat shield mounting fasteners and then the forward-most frame weldnut.

3. Place rectangular spacer with 3/8" carriage bolt through tow loop. Raise hitch into position over existing muffler heat shield(s). Notch bumper fascia as needed on drivers side.

4. Install 10mm fasteners on each side into existing weldnuts in the frame rails. Install 3/8" conical toothed washer and 3/8" nut through hitch plate and secure to hitch.

5. Torque all 10mm fasteners to 48 ft-lbs, and all 3/8" fasteners to 45 ft-lbs.

6. Trim and reattach plastic underbody panel as shown, if needed.

PERIODICALLY CHECK THIS RECEIVER HITCH TO ENSURE THAT ALL FASTENERS ARE TIGHT AND THAT ALL STRUCTURAL COMPONENTS ARE SOUND.

24751 / 247325