INSTALLATION INSTRUCTIONS HDX DROP STEP WHEEL-TO-WHEEL NERF STEP BARS


APPLICATION:

WESTIN®

2019-2021 Chevy Silverado/GMC Sierra 1500 Crew Cab (6.5 ft. Bed) (Excl. 2019 Silverado LD, Sierra 1500 Limited) 2019-2021 Chevy Silverado/GMC Sierra 1500 Double Cab (6.5 ft. Bed) PART NUMBER:

56-534695, 56-5346952, 56-534715, 56-5347152

		CONTENT	
ITEM	QUANTITY	DESCRIPTION	TOOLS NEEDED
1	2	STEP BAR ASSEMBLY (1 DRIVER, 1 PASSENGER)	13MM SOCKET
2	4	MOUNTING BRACKET	13MM WRENCH
3	2	CENTER MOUNTING BRACKET (1 DRIVER, 1 PASSENGER)	10MM SOCKET
4	1	TOP ISOLATOR BRACKET DRIVER	10MM WRENCH
5	2	BOTTOM ISOLATOR BRACKET (1 DRIVER, 1 PASSENGER)	15MM SOCKET
6	2	REINFORCEMENT LINK (1 DRIVER, 1 PASSENGER)	1/2" EXTENSION
7	4	ISOLATOR KIT	RATCHET
8	12	M8 U-NUT	TORQUE WRENCH
9	18	LONGER M8 HEX HEAD CAP SCREW	IMPACT GUN
10	12	SHORTER M8 HEX HEAD CAP SCREW	BREAKER BAR
11	32	M8 SPLIT LOCK WASHER	
12	32	M8 FLAT WASHER	
13	4	M12 SPLIT LOCK WASHER	
14	4	LONG M12 HEX HEAD CAP SCREW	
15	2	SHORT M12 HEX HEAD CAP SCREW	
16	6	M12 FLAT WASHER	
17	2	M12 SERRATED FLANGE NUT	
18	4	M12 HEX NUT	
19	1	TOP ISOLATOR BRACKET PASSENGER	
20	2	M8 FISHWIRE	
21	2	M8 HEX NUT	
22	2	M8 BOLT PLATE	
ITEM 1	DRIV	VER SIDE ITEMS SHOWN; PASSENGER SIDE OPPOSITE	ITEM 7
ITEM 2	ITEM 3	ITEM 4 ITEM 19 ITEM 5	ITEM 6




1

PROCEDURE


- 1. Remove contents from box, verify if all parts listed are present and free from damage. Carefully read and understand all instructions before attempting installation.
 - Failure to identify damage before installation could lead to a rejection of any claim.
- 2. Starting on the driver side, remove the rubber plugs located on the rocker panel at each mounting location. See **Figure 1**.
- 3. **For models with threaded holes:** At each bracket mounting location on the rocker panel there should be a welded factory nut.




- 4. Locate (1) Mounting Bracket (Item 2) and loosely secure it to the rocker panel using the provided hardware: (2) M8 hex head bolt, (2) M8 flat washer, and (2) M8 lock washer. See **Figure 2.**
- 5. Repeat Step 4 for all remaining bracket mounting locations. See Figure 9 on pg. 4

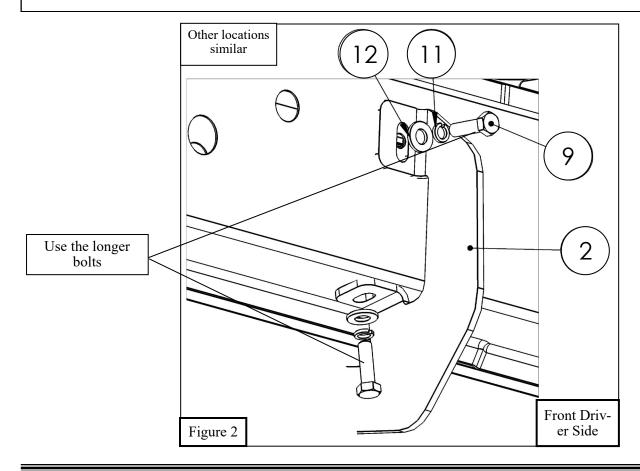


- 6. Use supplied M8 Bolt Plate and M8 Fish Wire to Fish the Bolt plate through the bed channel. See Figure 4
- 7. Remove the OEM Bed bolts to be used on the top Isolator Bracket (4). Then install the Top Isolator Bracket (4) using the OEM bolts, M8 Split Lock Washer, M8 Flat Washer, M8 Nut, and supplied M12 Bolt, M12 Lock Washer, and M12 Flat Washer. See **Figure 4 & 5.**

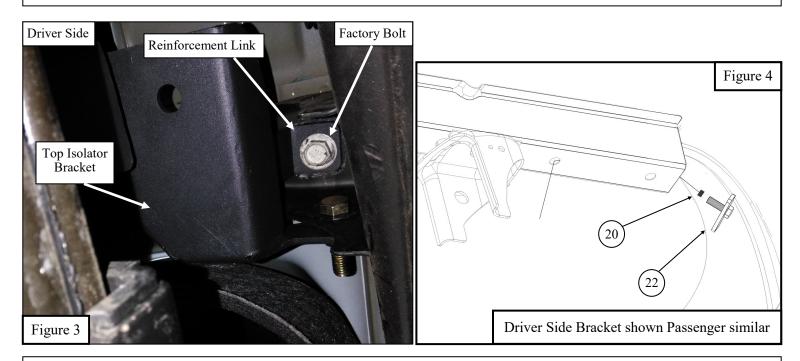



8. Attach the Bottom Isolator Bracket (5) to the Top Isolator Bracket (4) using the Isolator Kit (7) and hardware. See Figure 4.

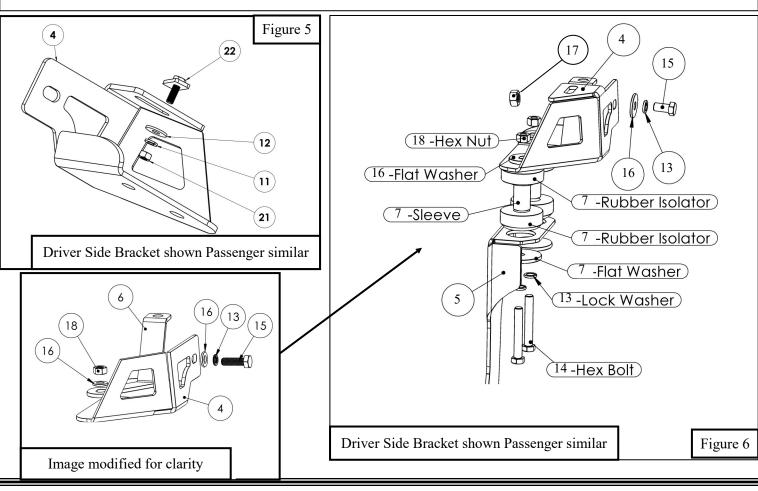

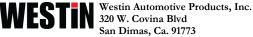

- 8. For Step Board installation, tilt board at an angle to insert brackets into mounting locations. With the previously installed mounting brackets use the supplied M8 hardware with the short M8 hex head bolt, then loosely install. See **Figures 7 & 8**.
- 9. Align and adjust the step bars and brackets as needed, then fully tighten all hardware: M8 to 15-18 ft-lbs, M12 to 55 ft-lbs...

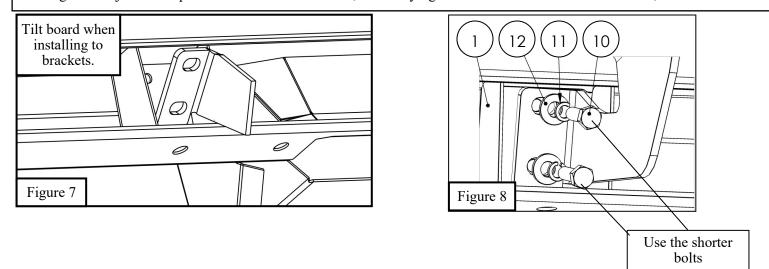

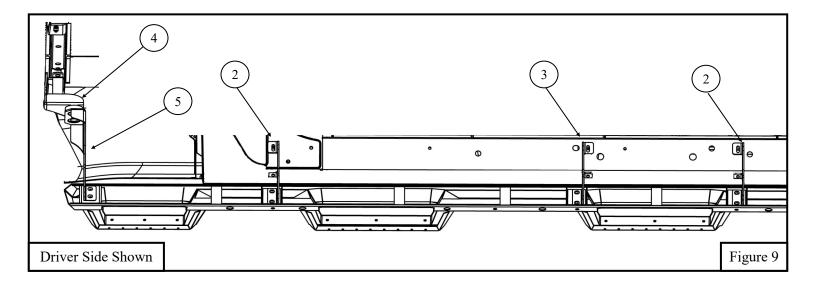



Care Instructions

- REGULAR WAXING IS RECOMMENDED. DO NOT USE ANY TYPE OF POLISH OR WAX THAT MAY CONTAIN ABRASIVES.
- STAINLESS STEEL PRODUCTS CAN BE CLEANED WITH MILD SOAP AND WATER. STAINLESS STEEL POLISH SHOULD BE USED TO POLISH SMALL SCRATCHES.
- GLOSS BLACK FINISHES SHOULD BE CLEANED WITH MILD SOAP AND WATER.



Westin Automotive Products, Inc. 320 W. Covina Blvd San Dimas, Ca. 91773





WARNING



Failure to follow these instructions could lead to death, personal injury, and / or property damage.

Failure to follow these instructions could lead to death, personal injury, and / or property damage.

FASTENERS:

All Westin supplied fasteners must be utilized and installed in accordance with the installation instructions and apply torque to the specifications as defined. DOUBLE CHECK ALL FASTENERS BEFORE INITIAL USE, AND PERIODICALLY IN THE FUTURE TO ENSURE PROPER FUNCTION AND SAFETY.

DRILLING:

Most Westin products do not require drilling for installation. If drilling is defined as required, use caution when drilling a vehicle. FAILURE TO REVIEW AN AREA TO BE DRILLED MAY RESULT IN PERSONAL INJURY AND/OR INJURY TO OTHERS AS WELL AS VEHICLE DAMAGE.

EYE PROTECTION:

ALWAYS WEAR SAFETY GLASSES OR GOGGLES DURING THE INSTALLATION PROCESS TO AVOID PERSONAL INJURY.

MAXIMUM TOWING/CARRYING CAPACITY: (if applicable)
The Westin Receiver Hitches will have a visible tow rating label affixed directly on the product. User should never exceed the vehicle manufacturers maximum tow and weight rating regardless of the capacity of the hitch. FAILURE TO FOLLOW THESE GUIDELINES WILL VOID THE WESTIN WARRANTY AND MAY RESULT IN PERSONAL INJURY AND/OR INJURY TO OTHERS AS WELL AS VEHICLE DAMAGE.

FOR CALIFORNIA RESIDENTS ONLY-PROP 65 WARNING:

Some products may contain chemicals such as DEHP, which can cause cancer, birth defects or other reproductive harm. For more info go to www.p65warnings.ca.gov